

RECENT RECALLS

Vehicle		Year	Description of Recall
BMW	525D XDrive	2014	<p><b>NHTSA Campaign Number: 15V188000</b></p> <p><b>Manufacturer</b> BMW of North America, LLC</p> <p><b>Components</b> EXTERIOR LIGHTING</p> <p><b>Summary</b></p> <p>BMW of North America, LLC (BMW) is recalling certain model year 2013-2014 528i, 528i xDrive, 535i, 535i xDrive, 550i, 550i xDrive, and M5 vehicles, 2013 ActiveHybrid 5 vehicles and 2014 525d xDrive vehicles. The rear reflex reflectors may not reflect enough light. As such, the vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment."</p> <p><b>Remedy</b></p> <p>BMW will notify owners, and dealers will replace the rear reflex reflectors, free of charge. <b>The recall is expected to begin on July 24, 2017.</b> Owners may contact BMW customer service at 1-800-525-7417.</p>
BMW	528I	2013-2014	
BMW	528XI	2013-2014	
BMW	535I	2013-2014	
BMW	535XI	2013-2014	
BMW	550I	2013-2014	
BMW	550XI	2013-2014	
BMW	ActiveHybrid 5	2013	
BMW	M5	2013-2014	

Aston Martin	DB11	2017	<p><b>NHTSA Campaign Number:</b> 17V411000</p> <p><b>Manufacturer</b> Aston Martin The Americas</p> <p><b>Components</b> TIRES</p> <p><b>Summary</b></p> <p>Aston Martin the Americas (Aston Martin) is recalling certain 2017 DB11 vehicles. The affected vehicles have a tire pressure monitoring system (TPMS) that may be incorrectly calibrated, resulting in the low tire pressure warning tell-tale not illuminating at the required minimum activation pressure. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 138, "Tire Pressure Monitoring Systems."</p> <p><b>Remedy</b></p> <p>Aston Martin will notify owners, and dealers will update the TPMS software, free of charge. <b>The recall is expected to begin in July 2017.</b> Owners may contact Aston Martin customer service at 1-888-923-9988. Aston Martin's number for this recall is RA-13-0025.</p>
--------------	------	------	--

<p>Buick      Envision</p>	<p>2016-2017</p>	<p><b>NHTSA Campaign Number:</b> 17V412000</p> <p><b>Manufacturer</b> General Motors LLC</p> <p><b>Components</b> STRUCTURE</p> <p><b>Summary</b></p> <p>General Motors LLC (GM) is recalling certain 2016-2017 Buick Envision vehicles. The affected vehicles received a replacement headliner as part of a repair. These service parts might not have had impact energy-absorbing foam blocks attached. As such, these vehicles fail to comply with the requirements of Federal Motor Safety Standard (FMVSS) number 201, "Occupant protection in interior impact."</p> <p><b>Remedy</b></p> <p>GM will notify owners, and dealers will replace the headliner assembly, free of charge. <b>The manufacturer has not yet provided a notification schedule.</b> Owners may contact Buick customer service at 1-800-521-7300. GM's number for this recall is 17275</p>
<p>Lexus      ES350</p>	<p>2017</p>	<p><b>NHTSA Campaign Number:</b> 17V415000</p> <p><b>Manufacturer</b> Toyota Motor Engineering &amp; Manufacturing</p> <p><b>Components</b> STEERING</p> <p><b>Summary</b></p> <p>Toyota Motor Engineering &amp; Manufacturing (Toyota) is recalling certain 2017 Lexus ES350 vehicles. The right-hand side tie rod lock nut may loosen over time.</p> <p><b>Remedy</b></p> <p>Toyota will notify owners, and dealers will inspect the lock nut and, if it is found loose, replace the lock nut, steering gear assembly, and tie rod assembly, free of charge. <b>The recall is expected to begin on July 17, 2017.</b> Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is HLC.</p>

<p>Honda</p>	<p>Accord</p>	<p>2013-2016</p>	<p><b>NHTSA Campaign Number:</b> 17V418000</p> <p><b>Manufacturer</b> Honda (American Honda Motor Co.)</p> <p><b>Components</b> ELECTRICAL SYSTEM</p> <p><b>Summary</b></p> <p>Honda (American Honda Motor Co.) is recalling certain 2013-2016 Honda Accord vehicles. The case for the battery sensor, part of the battery management system, may allow water to get in, potentially causing an electrical short.</p> <p><b>Remedy</b></p> <p>Honda will notify owners, and dealers will replace the sensor, free of charge. Remedy parts are currently unavailable. Dealers will perform an interim remedy of applying adhesive to the case to prevent water intrusion. <b>Interim notices are expected to be mailed on July 31, 2017. Owners will need to have the permanent remedy completed once they receive a second notice.</b> Owners may contact American Honda Customer Support Center at 1-888-234-2138. Honda's number for this recall is KG0.</p>
--------------	---------------	------------------	--

<p>Dodge Journey</p>	<p>2011-2015</p>	<p><b>NHTSA Campaign Number:</b> 17V432000</p> <p><b>Manufacturer</b> Chrysler (FCA US LLC)</p> <p><b>Components</b> AIR BAGS</p> <p><b>Summary</b></p> <p>Chrysler (FCA US LLC) is recalling certain 2011-2015 Dodge Journey vehicles. In the affected vehicles, the driver's frontal air bag may unexpectedly deploy if the air bag wiring harness gets chafed within the steering wheel and short circuits.</p> <p><b>Remedy</b></p> <p>Chrysler will notify owners, and dealers will inspect the air bag wiring within the steering wheel, replacing it if necessary. A protective cover will also be installed. These repairs will be made free of charge. <b>The recall is expected to begin August 21, 2017.</b> Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T47.</p>
<p>Chrysler 300 Dodge Challenger Dodge Charger Dodge Durango Jeep Grand Cherokee</p>	<p>2011-2014 2011-2014 2011-2014 2011-2014 2012-2014</p>	<p><b>NHTSA Campaign Number:</b> 17V435000</p> <p><b>Manufacturer</b> Chrysler (FCA US LLC)</p> <p><b>Components</b> ELECTRICAL SYSTEM</p> <p><b>Summary</b></p> <p>Chrysler (FCA US LLC) is recalling certain model year 2011-2014 Dodge Challenger, Dodge Charger, Chrysler 300, Dodge Durango, and 2012-2014 Jeep Grand Cherokee vehicles. The affected vehicles have electro-hydraulic power steering (EHPS) and are equipped with a 5.7L or a 3.6L engine and a 160, 180 or 220 amp alternator. In the affected vehicles, the alternator may suddenly fail.</p> <p><b>Remedy</b></p> <p>Chrysler will notify owners, and dealers will inspect the alternator and depending on the part number, will replace the alternator, if necessary, free of charge. <b>The recall is expected to begin on August 24, 2017.</b> Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T36.</p>



SafeCar.Gov Recall Lookup. <https://vinrcl.safercar.gov/vin/>